
5 POINT MAGICAL SUSPENSION RFM.5.M



5 POINT MAGICAL SUSPENSION RFM.5.M



May result in serious injury or death. ENSURE POWER IS OFF before commencing any work.

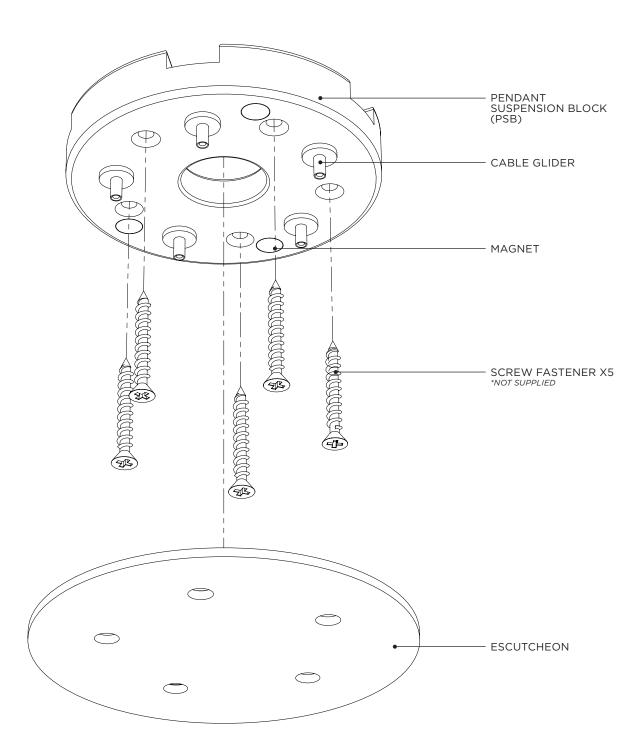

ALL ELECTRICAL connections must be made by a qualified electrician in accordance with the regulations and codes governing the area for which the CHRISTOPHER BOOTS Fixture is intended to be installed in. Failure to do so may result in serious harm or damage to property and life, at the owner's liability and expense.

CHRISTOPHER BOOTS will not be held liable for any damage caused from installation.



Ensure that the substrate is securely installed and is in accordance with local building regulations. Failure to do so may potentially result in serious harm or damage of property, at the owner's liability and expense.

CHRISTOPHER BOOTS will not be held liable for any damage caused from installation.



Refer to supplied WIRING DIAGRAM.

5 POINT MAGICAL SUSPENSION RFM.5.M




Wearing gloves, unpack the MEDIUM FLUSH CANOPY with care, ensuring not to scratch the surface of the ESCUTCHEON.

Separate the ESCUTCHEON from the PSB. These are connected via Magnets and can be pulled apart using moderate force.




Cut a Ø 120mm hole in the ceiling for the PSB.

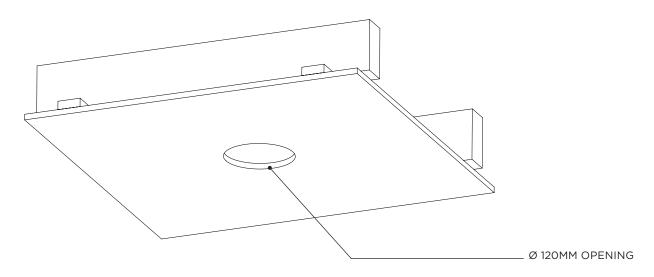



Installer to provide adequate load-bearing substrate, utilising ceiling joists where additional supvport is required. The mounting face of the substrate must be set back 20mm from the ceiling facade. For accurate placement of Cable Exits in the Substrate, use the PSB as a guide or refer to the provided template at the end of this document.

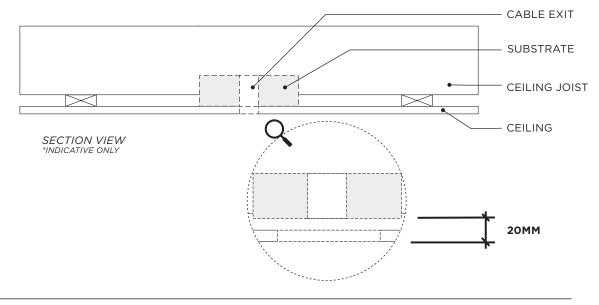


5 POINT MAGICAL SUSPENSION RFM.5.M




Prepare the remotely located 24V Power Supply cable to be connected to the Pendant.



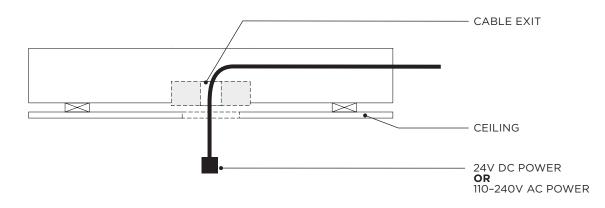




From the pendant, feed the PENDANT CABLES through the ESCUTCHEON as shown, take note of the labelled cables as they must correspond with the labelled cable gliders.

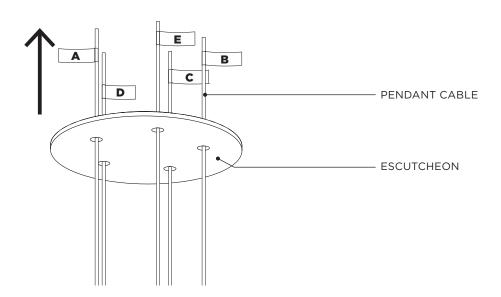

5 POINT MAGICAL SUSPENSION RFM.5.M




Feed the labelled PENDANT CABLES through the CABLE GLIDERS and pull back through the central hole of the PSB as shown.

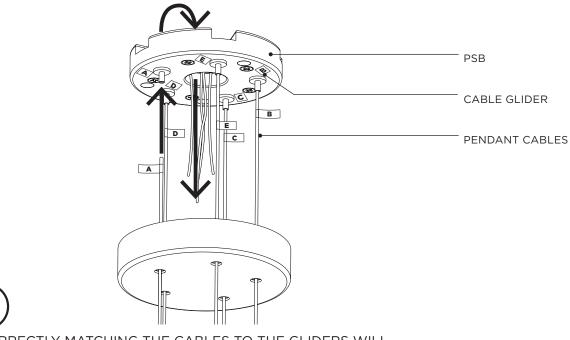

INCORRECTLY MATCHING THE CABLES TO THE GLIDERS WILL RESULT IN AN ELECTRICAL FAULT & CAUSE PRODUCT FAILURE.



Feed the 24V Power Supply cable through the central hole of the PSB and attach the PSB to Substrate with appropriate Fasteners.

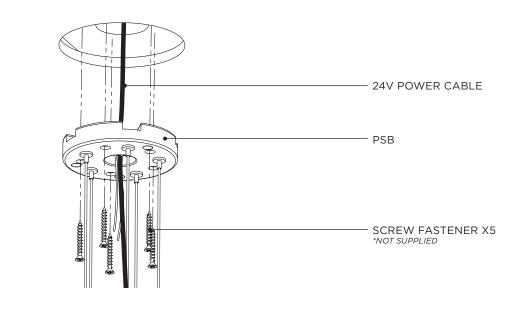


5 POINT MAGICAL SUSPENSION RFM.5.M



9


Connect the labelled MAGICAL SUSPENSION CABLES to the 24V Power supply and push the connection up into the ceiling. Refer to supplied WIRING DIAGRAM  $\rightarrow$ 



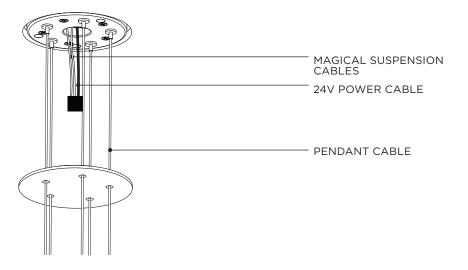

Raise the PENDANT, feeding excess cable through the CABLE GLIDERS. Set into position by gently lowering the PENDANT.


While supporting the pendant make necessary adjustments; To lower, press the cable gliders gently allowing excess cable to slide downwards. To raise, gently feed the cables up through the cable gliders. When satisfied with arrangement, ensure that neither the PENDANT or SUSPENSION components are touching.

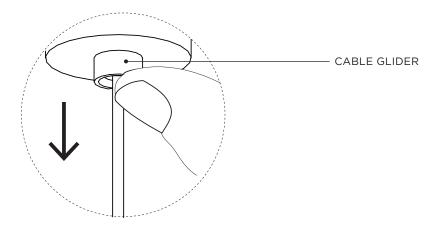

5 POINT MAGICAL SUSPENSION RFM.5.M




Raise ESCUTCHEON to the ceiling carefully until the Magnets engage. Ensure no contact between ESCUTCHEON and CABLE GLIDERS, as this may release the pendant cables.

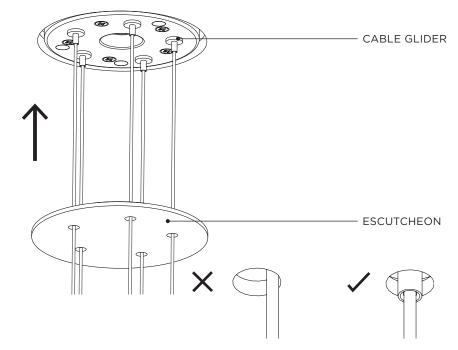



Once the Magnets are engaged, make any necessary final adjustments to the PENDANT.

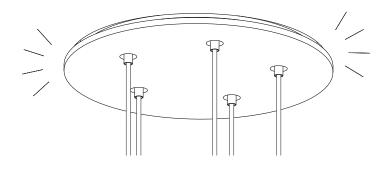




Conduct a final visual assessment of both the canopy and fixture to ensure all parts have been properly fitted and secured. Once satisfied that everything is in working order remove all remaining protective material which will now complete the installation process.

FINISH

5 POINT MAGICAL SUSPENSION RFM.5.M

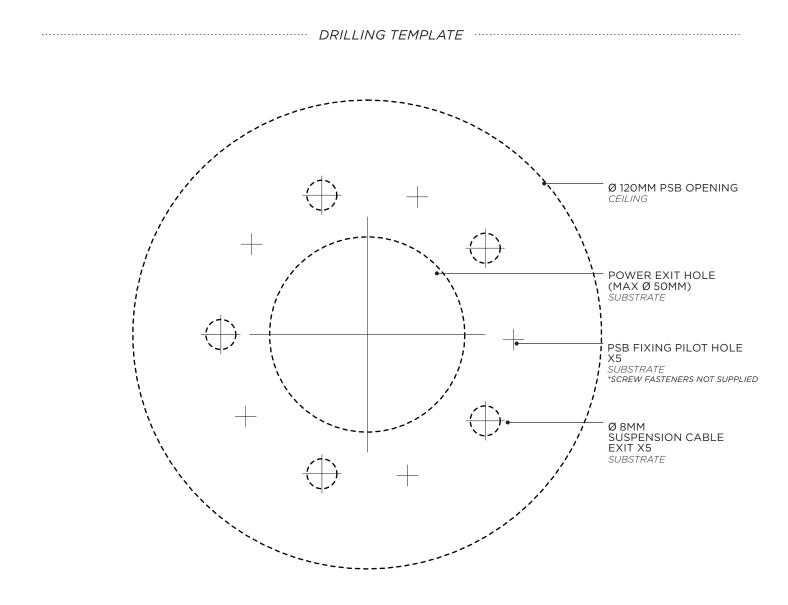

MEASURE BEFORE CUTTING AS TEMPLATE MAY NOT BE TO SCALE